



Antique Football

VINTAGE HELMET GRADING SERVICES



Certificate Number	CAP1-PGS-10075
Style Classification	1st Gen. Raincap Head Harness (CAP1)
Date of Manufacture	1907 - 1908
Manufacturer	P. Goldsmith Sons
Model No.	No. 36
Evaluation Date	5/10/2018
Evaluated By	PCH
Manufacturer's Logo	No
Location	
Material	
Exterior	Light Brown Leather and Ear Protectors Attached with Rivets
Interior	White Felt
Size	
Adult/Youth	
Hat Size	

Description
CAP1-PGS-10075 is a P. Goldsmith Sons No. 36 1st. Generation Raincap Head Harness manufactured between 1907 and 1908. Helmet ear protectors have been inscribed "Henry C. Fuller W.H.S. '08"

Provenance

None

AntiqueFootball makes no representation of condition or AFR Grade beyond the inspection date noted.

Registry QR Code:		AFR Grade:	EX
			85.65

<http://www.helmetregistry.com/helmets/10075.htm>



Inspection Summary				Grading Scale	
Criteria	AFR Score	Grade %	Comp. Grade	Score Range	Grade
Deformation	100.00	40.00%	40.00	95-100	MINT
Exterior Condition	69.00	35.00%	24.15	90 - 95	NEAR MINT
Interior	86.00	25.00%	21.50	85 - 90	EX
Overall Score			85.65	80 - 85	EX - VG
				75 - 80	VERY GOOD
				70 - 75	GOOD
Overall Grade			EX	65 - 70	GOOD - FAIR
				60 - 65	FAIR
				< 60	POOR

It is the mission of AntiqueFootball.com to provide accurate, unbiased research to vintage football equipment collectors and to share our passion for the humble beginnings of America's favorite pastime. With 10-years experience in identifying and dating vintage helmets, a library of over 200 vintage football equipment catalogs, and as the creator of the Vintage Football Helmet Classification System, AntiqueFootball is uniquely qualified to evaluate vintage football helmets.



AntiqueFootball, LLC
2215 Plank Road #170
Fredericksburg, VA 22401
(540) 273-7498

I hereby certify that I have completed this vintage football helmet grading evaluation in accordance with the Vintage Helmet Grading Protocol and the Helmet Grading Code of Ethics established by AntiqueFootball.

Name	
P. Chris Hornung	
Signature	
Date	5/10/2018
Certificate is invalid without AF wax seal	



Antique Football

VINTAGE HELMET GRADING SERVICES



Deformation		Body/Crown						Ear Pads		Deduction	Notes
		Symmetrical			Asymmetrical			Right	Left		
		Longitudinal	Lateral	Vertical	Longitudinal	Lateral	Vertical				
Deformation	Cupping			X				X		0.0	No cupping
	Compression							X	X	0.0	No compression
	Shear	X	X	X						0.0	No shear
Total Deformation Deductions										0.0	

Grading Key: A = Slight; B = Minor; C = Moderate; D = Significant; F = Severe





Exterior Condition		Location								Deduction	Notes
		Top	Front	Right Body	Left Body	Right Ear	Left Ear	Rear	Chinstrap		
Wear	Material Loss								F	20.0	1 Missing chinstrap
	Material Repairs									0.0	No material repairs evident
	Insect/Rodent Damage									0.0	No insect/rodent damage
	Tearing/Fraying									0.0	No tearing/fraying
	Surface Abrasions/Scuffs/Scars				B			B		4.0	2 Minor surface abrasions on left body and ear
Total Wear Deductions										24.0	
Desiccation	Stitch Disintegration/Damage		A						X	1.0	3 Slight stitch pull at left front
	Fat Spews								X	0.0	No fat spews
	Embrittlement								X	0.0	Embrittlement deductions superseded by cracking/flaking deductions
	Shrinkage Depressions/Creasing		A			B		B		7.0	4 Slight to minor shrinkage depressions on front and rear, creasing on both ear protectors
	Crazing/Cracking	B							X	2.0	5 Minor crazing of leather on front
	Flaking/Spalling		A	A	A			A	X	16.0	6 Slight flaking of leather on front, rear, left body
	Acidic Hydrolysis/Red Rot								X	0.0	No visible rot
Total Desiccation Deductions										26.0	
Discoloration	Oxidation	B	B	B	B	C	B	B	X	8.0	7 Minor to moderate oxidation of exterior leather surfaces
	Chemical Staining									0.0	No chemical staining
	Soiling/Staining									0.0	No soiling/staining
	Applied Treatments/Residue									0.0	No applied treatments/residue
	Foreign Markings					B		B		4.0	8 Period player inscription including '08 date on both ear protectors
	Metal Corrosion/Salt Accretions									0.0	No metal corrosion
	Microbic Deterioration									0.0	No sign of mold or bacteriological deterioration
Total Discoloration Deductions										12.0	
Total Exterior Condition Deductions										62.0	

Grading Key: A = Slight; B = Minor; C = Moderate; D = Significant; F = Severe



Antique Football

VINTAGE HELMET GRADING SERVICES

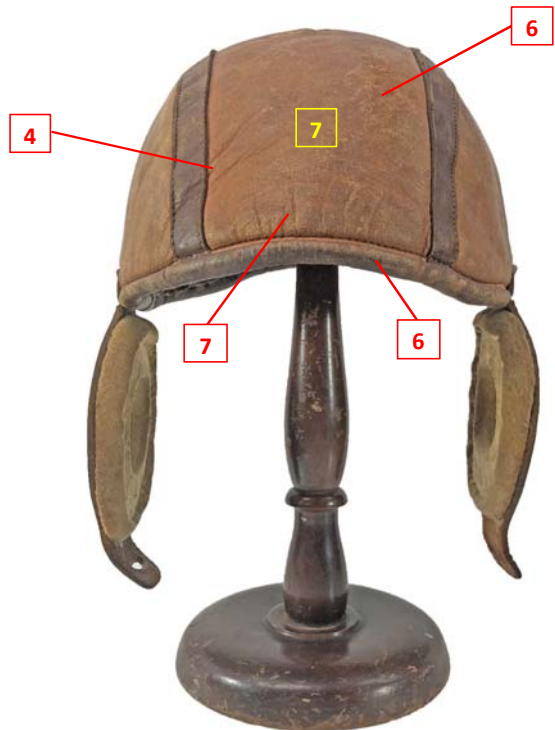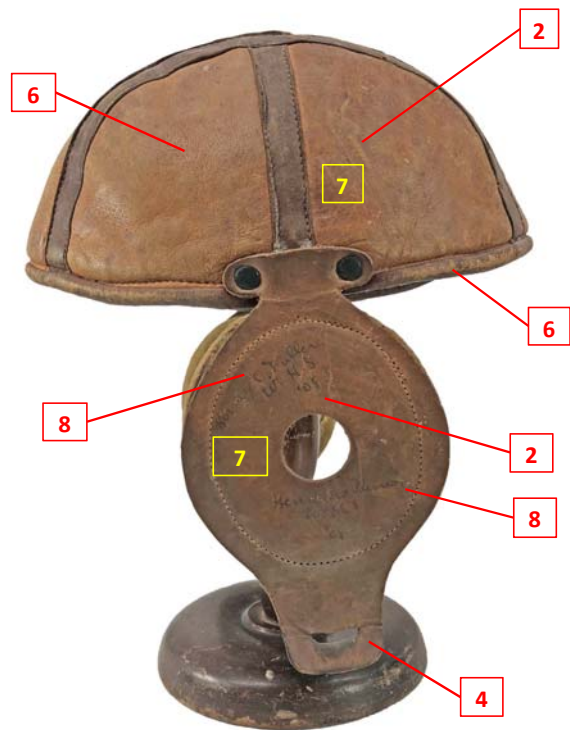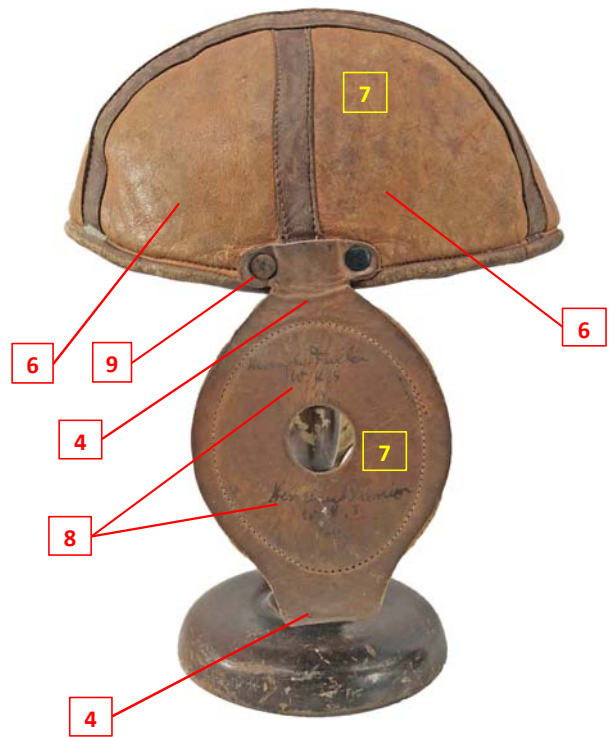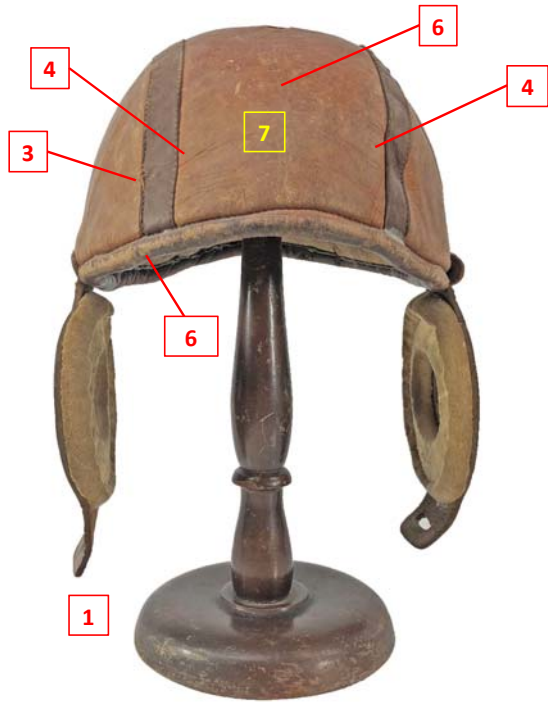




Antique Football

VINTAGE HELMET GRADING SERVICES



	Interior Condition	Location							Deduction	Notes
		Crown	Front	Right Side	Left Side	Right Ear	Left Ear	Rear		
Shell	Material Loss								0.0	No material loss
	Material Repairs								0.0	No material repairs
	Stitch Disintegration/Damage								0.0	No interior stitch damage
	Staining/Discoloration								0.0	No staining/discoloration
	Insect/Rodent Damage								0.0	No insect/rodent damage
	Tearing/Fraying								0.0	No tearing or fraying
	Foreign Markings								0.0	No foreign markings
	Embrittlement								0.0	No embrittlement
	Crazing/Cracking								0.0	No crazing/cracking
	Flaking/Spalling								0.0	No flaking/spalling
	Acidic Hydrolysis/Red Rot								0.0	No evidence of hydrolysis or rot
Total Shell Deductions									0.0	
Padding	Material Loss								0.0	No material loss
	Insect/Rodent Damage								0.0	No insect/rodent damage
	Staining/Discoloration	C	C	C	C	C	C	C	28.0	9 Moderate staining of interior felt padding
	Foreign Markings								0.0	No foreign markings
	Odor								0.0	No detectable odor
Total Padding Deductions									28.0	
Total Interior Condition Deductions									28.0	

Grading Key: A = Slight; B = Minor; C = Moderate; D = Significant; F = Severe

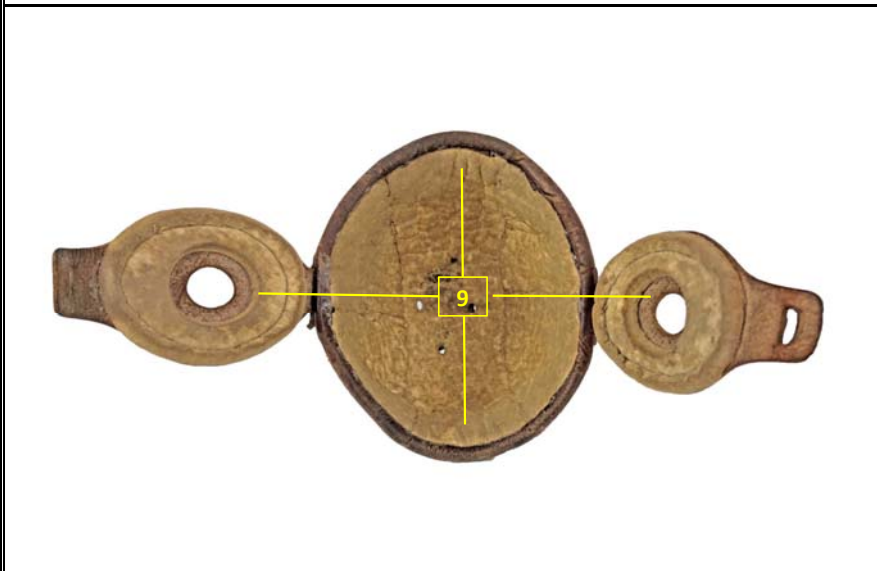



Antique Football

VINTAGE HELMET GRADING SERVICES





Antique Football


VINTAGE HELMET GRADING SERVICES



About the Raincap Head Harness

The Raincap style football helmet refers to soft leather, canvas, or moleskin helmets with rounded crowns that could be folded in half easily. Countless variations of the raincap were sold over a 30 year period from 1898 - 1928. Raincaps typically possess independent ear flaps sewn onto the body of the harness, which is padded with cotton or wool. Raincap-styles are separated into two periods. First generation raincaps lacked a rear neck protector, and were generally produced before 1906. Second generation raincaps include the rear neck protector and were produced after 1905.


Distiniguishing Characteristics

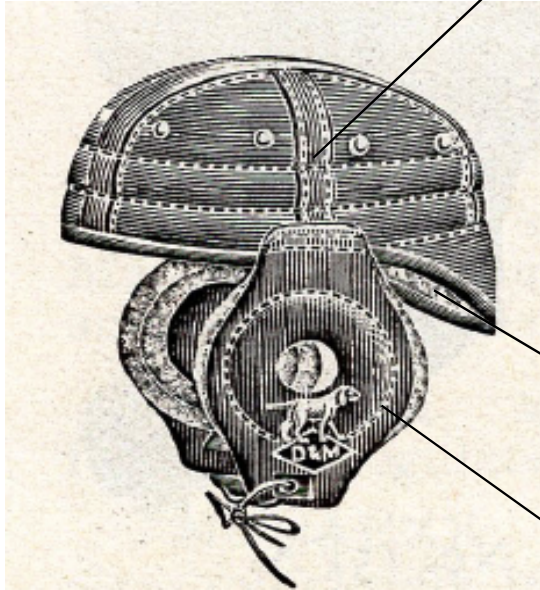

Soft Leather, Canvas, or Moleskin Body

Cotton or Wool Padded Interior

Independent Ear Flaps Sewn to Body

Nos. 45-40-36

No. 36—Made of tan colored sheep throughout, is lightly padded with felt, has leather ears.Each **\$1.25**

1906 P. Goldsmith Sons Fall & Winter Catalog